


## Mini Weighers

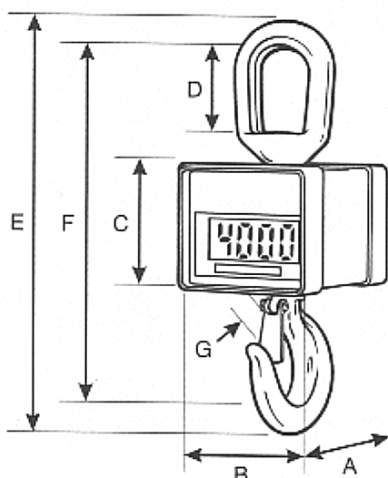

- Automatic zero
- Low battery signal
- Overload indication
- Kg, Lbs, kN, daN,
- Automatic shutdown after 20 minutes
- Connect to remote readout, PC or printer
- Tare over full range
- Peak hold

Maximum Load (tonne)	0.25	0.5	1.25
Accuracy (+/- kg)	0.5	1	2.5
Minimum Increment (kg)	0.1	0.2	0.5
Weight of Unit (kg)	4.7	4.7	4.7
Test Load (t)	0.5	1	2.5
Maximum Display (kg)	250	500	1250
Operating Temp (°C)	-10°C to +50°C	-10°C to +50°C	-10°C to +50°C
Battery Type	3 x 1.5 V AA or R6	3 x 1.5 V AA or R6	3 x 1.5 V AA or R6
Battery Life (hours)	120	120	120
Display Height (mm)	25	25	25
Dimension A (mm)	160	160	160
Dimension B (mm)	138	138	138
Dimension C (mm)	166	166	166
Dimension D (mm)	62	62	62
Dimension E (mm)	440	440	440
Dimension F (mm)	390	390	390
Dimension G (mm)	32	32	32

Maximum Load (tonnes)	2.5	5	12.5
Accuracy (+/- kg)	5	10	25
Minimum Increment (kg)	1	2	5
Weight of Unit (kg)	7	8.5	21
Test Load (t)	5	10	25
Maximum Display (kg)	2500	5000	1250
Operating Temp (°C)	-10°C to +50°C	-10°C to +50°C	-10°C to +50°C
Battery Type	3 x 1.5 V C/LR14	3 x 1.5 V C/LR14	3 x 1.5 V C/LR14
Battery Life (hrs)	700	700	700
Display Height (mm)	44	44	44
Dimension A (mm)	177	177	205
Dimension B (mm)	200	200	200
Dimension C (mm)	166	166	166
Dimension D (mm)	56	75	115
Dimension E (mm)	440	520	700
Dimension F (mm)	391	449	600
Dimension G (mm)	32	40	57